



Baugeologisches
Büro Bauer GmbH
Domagkstraße 1a
80807 München


Hangstabilität Pullach - Josef-Breher-Weg

Projektnummer 03793

Anlage Nr. 4.2

M = 1:50

DPH05/15

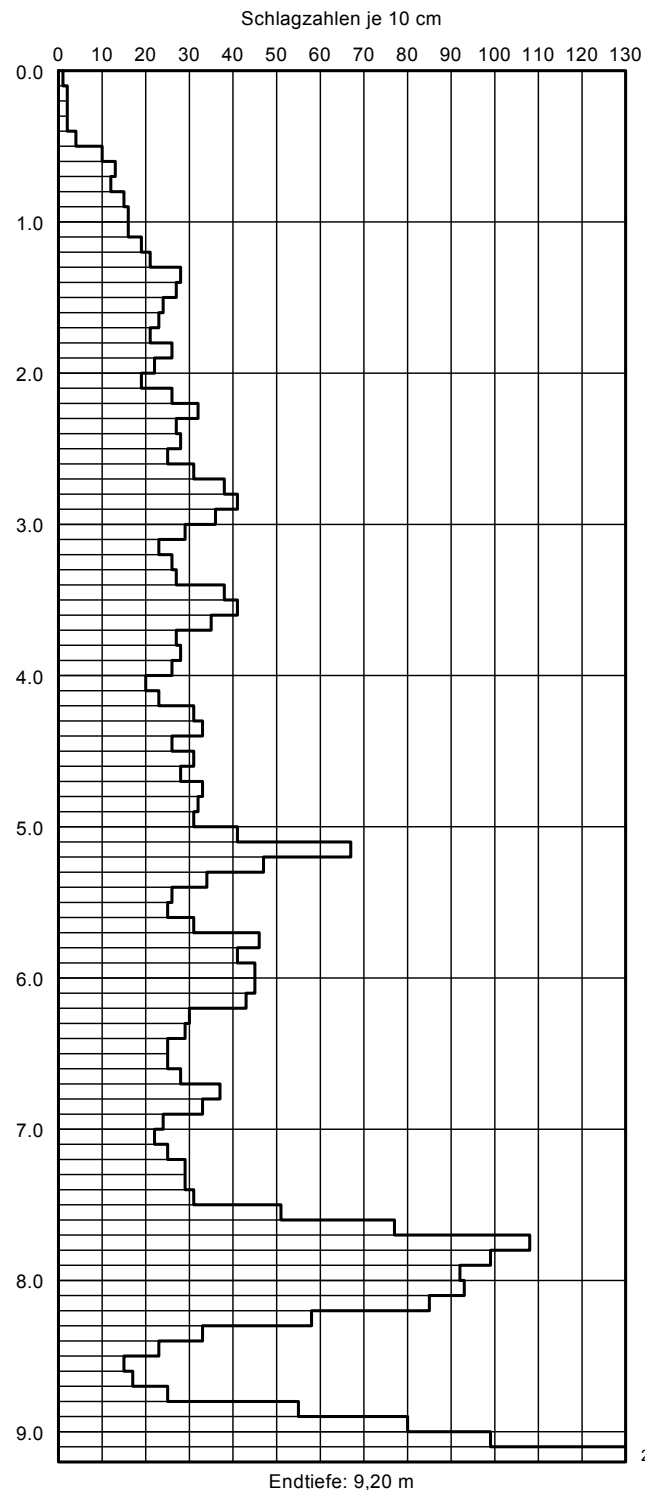


Tiefe [m]	N ₁₀	Tiefe [m]	N ₁₀
0.10	1	6.10	45
0.20	2	6.20	43
0.30	2	6.30	30
0.40	2	6.40	29
0.50	4	6.50	25
0.60	10	6.60	25
0.70	13	6.70	28
0.80	12	6.80	37
0.90	15	6.90	33
1.00	16	7.00	24
1.10	16	7.10	22
1.20	19	7.20	25
1.30	21	7.30	29
1.40	28	7.40	29
1.50	27	7.50	31
1.60	24	7.60	51
1.70	23	7.70	77
1.80	21	7.80	108
1.90	26	7.90	99
2.00	22	8.00	92
2.10	19	8.10	93
2.20	26	8.20	85
2.30	32	8.30	58
2.40	27	8.40	33
2.50	28	8.50	23
2.60	25	8.60	15
2.70	31	8.70	17
2.80	38	8.80	25
2.90	41	8.90	55
3.00	36	9.00	80
3.10	29	9.10	99
3.20	23	9.20	232
3.30	26		
3.40	27		
3.50	38		
3.60	41		
3.70	35		
3.80	27		
3.90	28		
4.00	26		
4.10	20		
4.20	23		
4.30	31		
4.40	33		
4.50	26		
4.60	31		
4.70	28		
4.80	33		
4.90	32		
5.00	31		
5.10	41		
5.20	67		
5.30	47		
5.40	34		
5.50	26		
5.60	25		
5.70	31		
5.80	46		
5.90	41		
6.00	45		

232



DPH01/15

M = 1:50

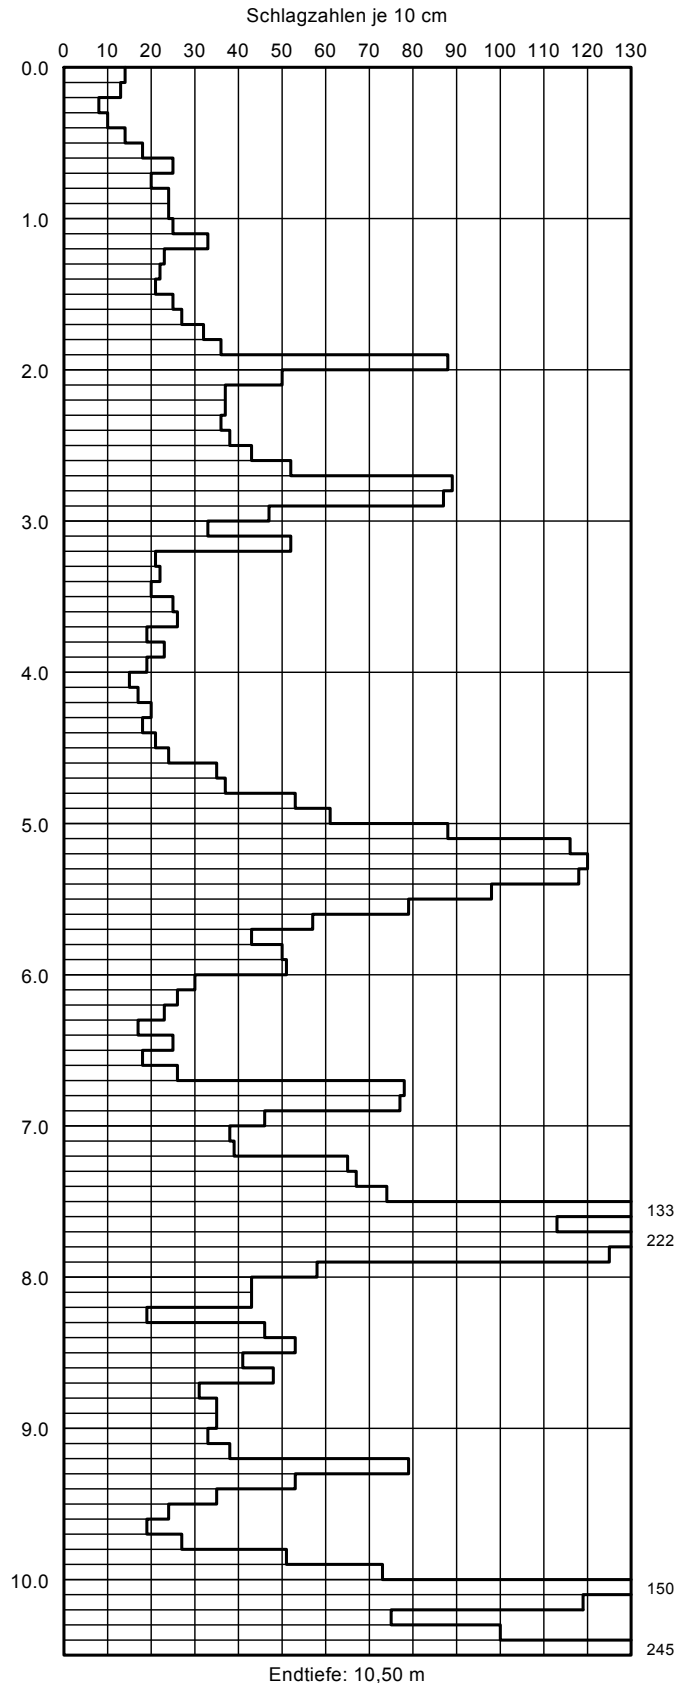

Tiefe [m]	N ₁₀	Tiefe [m]	N ₁₀
0.10	14	7.10	38
0.20	13	7.20	39
0.30	8	7.30	65
0.40	10	7.40	67
0.50	14	7.50	74
0.60	18	7.60	133
0.70	25	7.70	113
0.80	20	7.80	222
0.90	24	7.90	125
1.00	24	8.00	58
1.10	25	8.10	43
1.20	33	8.20	43
1.30	23	8.30	19
1.40	22	8.40	46
1.50	21	8.50	53
1.60	25	8.60	41
1.70	27	8.70	48
1.80	32	8.80	31
1.90	36	8.90	35
2.00	88	9.00	35
2.10	50	9.10	33
2.20	37	9.20	38
2.30	37	9.30	79
2.40	36	9.40	53
2.50	38	9.50	35
2.60	43	9.60	24
2.70	52	9.70	19
2.80	89	9.80	27
2.90	87	9.90	51
3.00	47	10.00	73
3.10	33	10.10	150
3.20	52	10.20	119
3.30	21	10.30	75
3.40	22	10.40	100
3.50	20	10.50	245
3.60	25		
3.70	26		
3.80	19		
3.90	23		
4.00	19		
4.10	15		
4.20	17		
4.30	20		
4.40	18		
4.50	21		
4.60	24		
4.70	35		
4.80	37		
4.90	53		
5.00	61		
5.10	88		
5.20	116		
5.30	120		
5.40	118		
5.50	98		
5.60	79		
5.70	57		
5.80	43		
5.90	50		
6.00	51		
6.10	30		
6.20	26		
6.30	23		
6.40	17		
6.50	25		
6.60	18		
6.70	26		
6.80	78		
6.90	77		
7.00	46		



Baugeologisches
Büro Bauer GmbH
Domagkstraße 1a
80807 München


Hangstabilität Pullach - Josef-Breher-Weg

Projektnummer 03793

Anlage Nr. 4.2

M = 1:50

DPH02/15

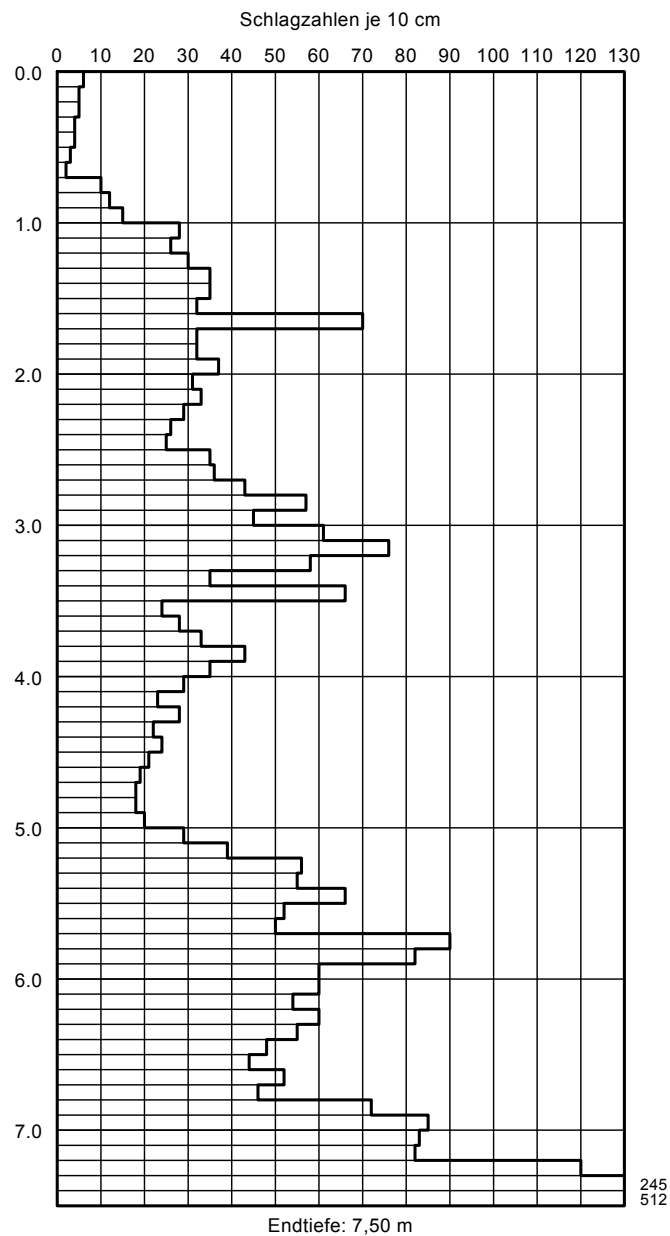


Tiefe [m]	N ₁₀	Tiefe [m]	N ₁₀
0.10	6	5.10	29
0.20	5	5.20	39
0.30	5	5.30	56
0.40	4	5.40	55
0.50	4	5.50	66
0.60	3	5.60	52
0.70	2	5.70	50
0.80	10	5.80	90
0.90	12	5.90	82
1.00	15	6.00	60
1.10	28	6.10	60
1.20	26	6.20	54
1.30	30	6.30	60
1.40	35	6.40	55
1.50	35	6.50	48
1.60	32	6.60	44
1.70	70	6.70	52
1.80	32	6.80	46
1.90	32	6.90	72
2.00	37	7.00	85
2.10	31	7.10	83
2.20	33	7.20	82
2.30	29	7.30	120
2.40	26	7.40	245
2.50	25	7.50	512
2.60	35		
2.70	36		
2.80	43		
2.90	57		
3.00	45		
3.10	61		
3.20	76		
3.30	58		
3.40	35		
3.50	66		
3.60	24		
3.70	28		
3.80	33		
3.90	43		
4.00	35		
4.10	29		
4.20	23		
4.30	28		
4.40	22		
4.50	24		
4.60	21		
4.70	19		
4.80	18		
4.90	18		
5.00	20		



M = 1:50

DPH03/15

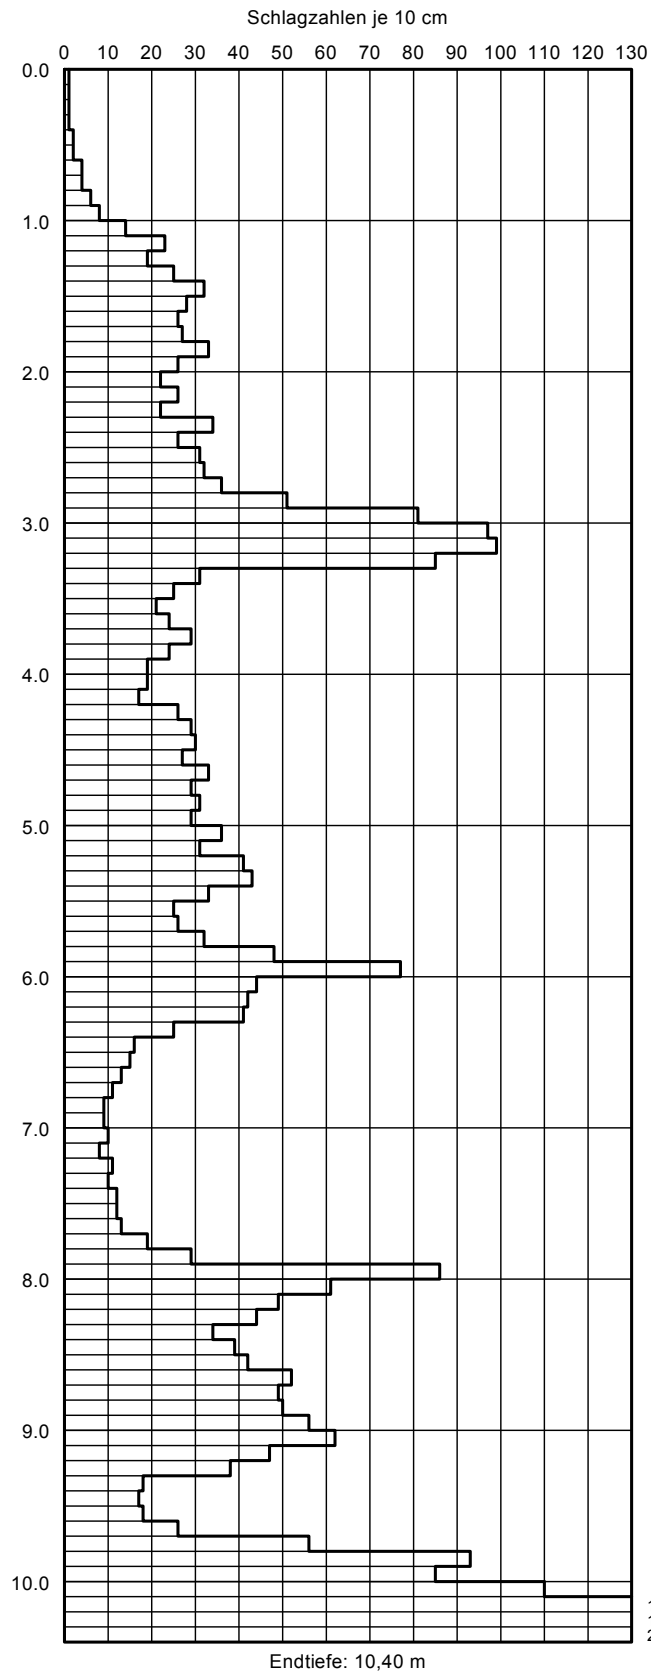

Tiefe [m]	N ₁₀	Tiefe [m]	N ₁₀
0.10	1	7.10	10
0.20	1	7.20	8
0.30	1	7.30	11
0.40	1	7.40	10
0.50	2	7.50	12
0.60	2	7.60	12
0.70	4	7.70	13
0.80	4	7.80	19
0.90	6	7.90	29
1.00	8	8.00	86
1.10	14	8.10	61
1.20	23	8.20	49
1.30	19	8.30	44
1.40	25	8.40	34
1.50	32	8.50	39
1.60	28	8.60	42
1.70	26	8.70	52
1.80	27	8.80	49
1.90	33	8.90	50
2.00	26	9.00	56
2.10	22	9.10	62
2.20	26	9.20	47
2.30	22	9.30	38
2.40	34	9.40	18
2.50	26	9.50	17
2.60	31	9.60	18
2.70	32	9.70	26
2.80	36	9.80	56
2.90	51	9.90	93
3.00	81	10.00	85
3.10	97	10.10	110
3.20	99	10.20	156
3.30	85	10.30	196
3.40	31	10.40	221
3.50	25		
3.60	21		
3.70	24		
3.80	29		
3.90	24		
4.00	19		
4.10	19		
4.20	17		
4.30	26		
4.40	29		
4.50	30		
4.60	27		
4.70	33		
4.80	29		
4.90	31		
5.00	29		
5.10	36		
5.20	31		
5.30	41		
5.40	43		
5.50	33		
5.60	25		
5.70	26		
5.80	32		
5.90	48		
6.00	77		
6.10	44		
6.20	42		
6.30	41		
6.40	25		
6.50	16		
6.60	15		
6.70	13		
6.80	11		
6.90	9		
7.00	9		



Baugeologisches
Büro Bauer GmbH
Domagkstraße 1a
80807 München


Hangstabilität Pullach - Josef-Breher-Weg

Projektnummer 03793

Anlage Nr. 4.2

M = 1:50

DPH04/15

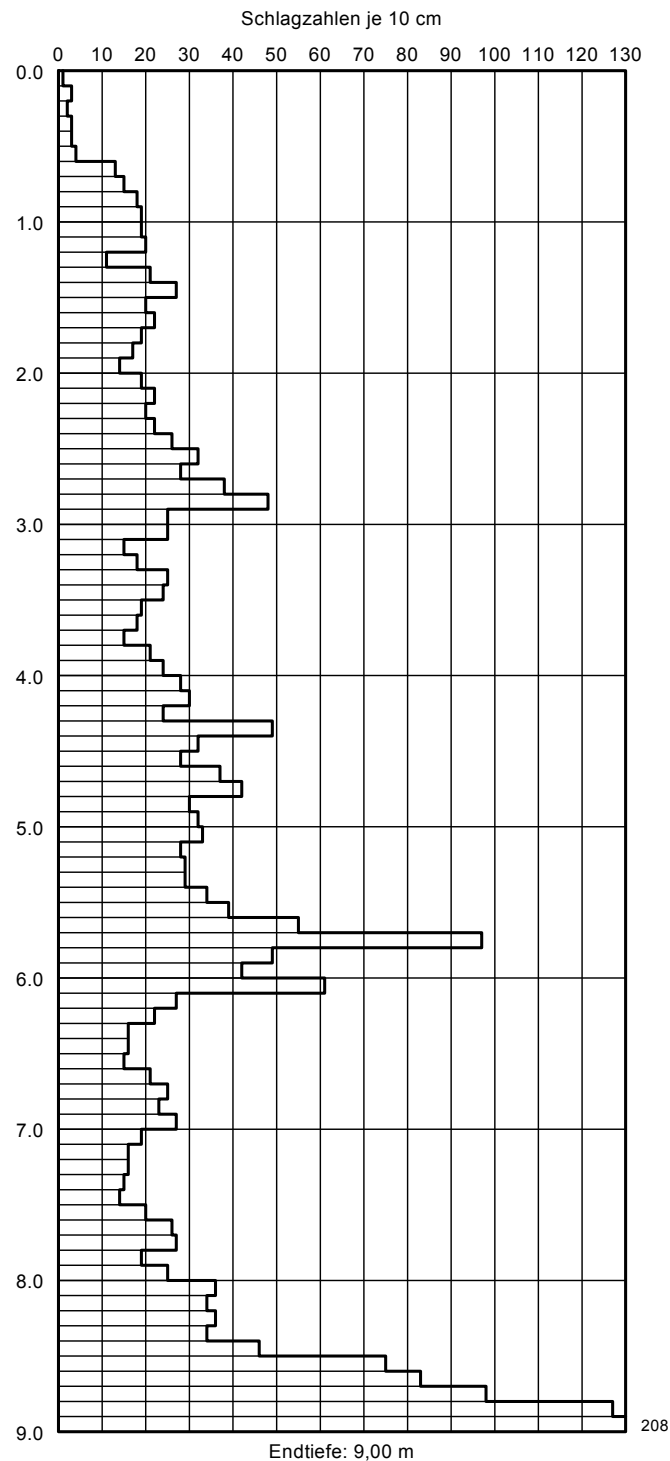

Tiefe [m]	N ₁₀	Tiefe [m]	N ₁₀
0.10	1	6.10	61
0.20	3	6.20	27
0.30	2	6.30	22
0.40	3	6.40	16
0.50	3	6.50	16
0.60	4	6.60	15
0.70	13	6.70	21
0.80	15	6.80	25
0.90	18	6.90	23
1.00	19	7.00	27
1.10	19	7.10	19
1.20	20	7.20	16
1.30	11	7.30	16
1.40	21	7.40	15
1.50	27	7.50	14
1.60	20	7.60	20
1.70	22	7.70	26
1.80	19	7.80	27
1.90	17	7.90	19
2.00	14	8.00	25
2.10	19	8.10	36
2.20	22	8.20	34
2.30	20	8.30	36
2.40	22	8.40	34
2.50	26	8.50	46
2.60	32	8.60	75
2.70	28	8.70	83
2.80	38	8.80	98
2.90	48	8.90	127
3.00	25	9.00	208
3.10	25		
3.20	15		
3.30	18		
3.40	25		
3.50	24		
3.60	19		
3.70	18		
3.80	15		
3.90	21		
4.00	24		
4.10	28		
4.20	30		
4.30	24		
4.40	49		
4.50	32		
4.60	28		
4.70	37		
4.80	42		
4.90	30		
5.00	32		
5.10	33		
5.20	28		
5.30	29		
5.40	29		
5.50	34		
5.60	39		
5.70	55		
5.80	97		
5.90	49		
6.00	42		